General Motors Upfitter Integration





Subject: Removing/Re-Installation of Door Water Deflectors

Models: Chevrolet Caprice PPV

Model Years: 2012 - 2017

Date: January 08, 2013

Revision Date: June 6, 2017

ADVISORY:

This UI Bulletin is being created using information contained in General Motors Service Information Document ID 1990961

This bulletin was recently updated to reflect model year coverage of 2012 - 2017

Condition:

Reported Water Intrusion into the Passenger Compartment on Caprice PPVs following the addition of special equipment to which the water deflector has been removed to gain access to the inside of the door.

Recommendation:

To eliminate the possibility of water intrusion into the vehicle passenger compartment, the steps on the following pages should be followed when removing and re-installing the door water deflector(s).

General Motors Upfitter Integration

http://www.gmupfitter.com • 1-800-875-4742 (Upfitter Hotline)

Bulletin #107d

June 6, 2017


Disclaimer: GM Upfitter Integration Technical Bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service and/or modification of a vehicle. These properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. Contact GM Upfitter Integration for information on whether the information is applicable your vehicle.

UI Bulletin #107d




Removal Procedure

- 1. Remove the door trim panel.
- 2. Remove the speaker.

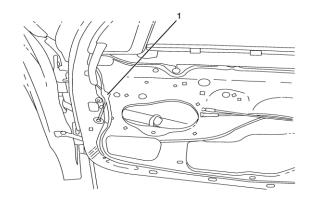

3. Detach the wiring harness to door retaining clip (1).

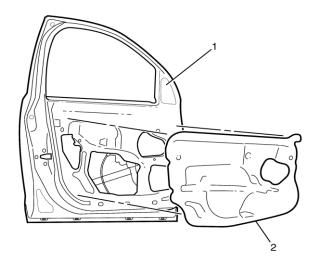

4. Remove the water deflector (2) from the door (1). **Important:** Pull the water deflector (2) from the door (1) to release the adhesive bond.

General Motors Upfitter Integration

http://www.gmupfitter.com • 1-800-875-4742 (Upfitter Hotline)


Bulletin #107d

June 6, 2017

Disclaimer: GM Upfitter Integration Technical Bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service and/or modification of a vehicle. These properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. Contact GM Upfitter Integration for information on whether the information is applicable your vehicle.


UI Bulletin #107d

Installation Procedure

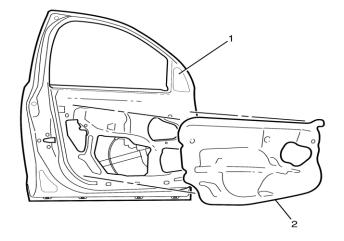

1. Install the water deflector (2) to the door (1). **Important:** Firmly press the water deflector (2) where adhesive is applied to make sure of a water tight seal to the door (1).

NOTE: For higher level of assurance of a complete seal...a hand held roller is recommended to increase the "wet-out" of the adhesive between the surfaces of the deflector and the door.

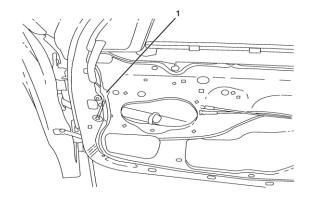

- 2. Attach the wiring harness to door retaining clip (1).
- 3. Install the speaker.
- 4. Install the door trim panel.

General Motors Upfitter Integration

http://www.gmupfitter.com • 1-800-875-4742 (Upfitter Hotline)

Bulletin #107d

June 6, 2017

Disclaimer: GM Upfitter Integration Technical Bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service and/or modification of a vehicle. These properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. Contact GM Upfitter Integration for information on whether the information is applicable your vehicle.