

Subject	Installation After-Market Trailer Brake Controller								
Model Years	2019 and Beyond								
Affected									
Models	Chevrolet MD Silverado								
Affected	(4500/5500/6500) w/o RPO JL1 or UY7								
Origination	August 26, 2019								
Date	August 20, 2017								
Revision	N/A								
Date									

UI Bulletin #158

ADVISORY:

Condition/Concern:

Some Customers/Upfitters may be interested in adding an after-market trailer brake controller when the vehicle was not equipped with the Integrated Trailer Brake Controller (RPO JL1) and/or Trailer Wiring provisions (RPO UY7).

Repair/Recommendation:

For the New Medium Silverado trucks UY7 is only available when the vehicle is ordered and/or built with JL1. The necessary supporting wiring/circuits can be added to the vehicle for use with an after-market trailer brake controller. The following information will provide the locations and requirements. An additional trailer plug receptacle will need to be purchased and installed.

The following circuits must be added to the chassis and routed to the rear of the frame.

2109 is Park Lamps from X104_A3

1624 is the Trailer Backup Lamp from X104 B2

318 is the Stop/Turn LT from X104_G3

319 is the Stop/Turn RT from X104_H3

1242 Trailer Battery+ from X104 H6

22 Trailer Ground - can get from frame

47 Electric Brake (Output from BK controller X138_32 (40-way connector APTIV# 13608632)

The bulk of the circuits that need to be added are in Connector X4 of the Underhood Electrical Center (UEC - X50A) (see item 3 - figure 1)

General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #158

August 26, 2019

Add to UEC Connector X4



UI Bulletin #158

The Output from AM Brake controller is in the Chassis inline connector X138_32 (40-way connector) located next or near the UEC (refer to item 6 in figure 2)

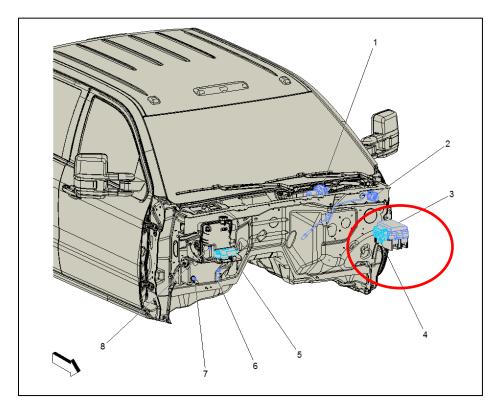


Figure 1

General Motors Upfitter Integration


http://www.gmupfitter.com

Bulletin #158

August 26, 2019

UI Bulletin #158



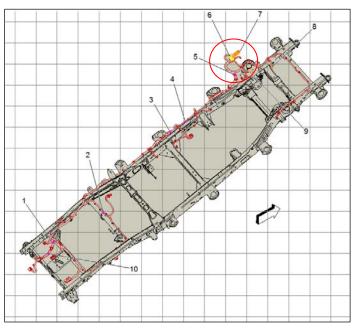



X50A Fuse Block - Underhood Bottom View

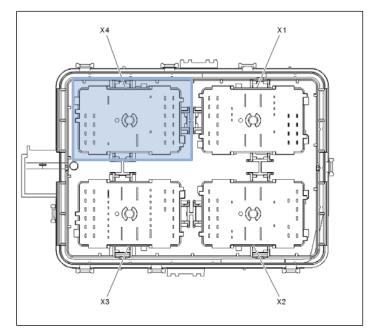


Figure 3

General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #158


Page | 3

August 26, 2019

UI Bulletin #158



X50A Fuse Block - Underhood X4

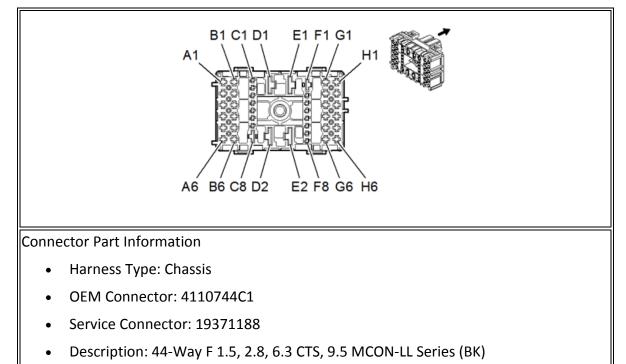

	Terminal Part Information											
Terminal Type ID	Terminated Lead	Diagnostic Test Probe	Terminal Removal Tool	Service Terminal	Tray Name	Core Crimp	Insulation Crimp					
I	19332365	J-35616-14 (GN)	J-38125-215A	Not Available	Not Available	Not Available	Not Available					
II	19332366	J-35616-35 (VT)	J-38125-215A	Not Available	Not Available	Not Available	Not Available					
	19332366	J-35616-35 (VT)	J-38125-215A	Not Required	Not Required	Not Required	Not Required					
IV	84779405	J-35616-35 (VT)	No Tool Required	13943933	Not Available	Not Available	Not Available					
v	Not Required	J-35616-4A (PU)	No Tool Required	Not Available	Not Available	Not Available	Not Available					

General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #158

August 26, 2019

UI Bulletin #158

	X50A Fuse Block - Underhood X4									
Pin	Size	Color	Circuit	Function	Terminal Type ID	Option				
A1	0.75	VT/GY	1054	Stop Lamp Control 2	II	—				
A2	2	VT/GY	709	Left Park Lamp Control	III	—				
A3	4	GY/BN	2109	Trailer Park Lamp Control	IV	—				
A4	2	GY/BN	309	Right Park Lamp Control	III	—				
A5	-	-	_	Not Occupied	_	—				
A6	0.5	РК	1739	Run/Crank Ignition 1 Voltage 17	II	—				
B1	2	GN/WH	24	Backup Lamp Control	III	—				
B2	2	WH/GN	1624	Trailer Backup Lamp Control	Ш	—				
B3	—	-	_	Not Occupied	_	—				
B4	2	YE/BN	618	Left Rear Turn Signal Lamp Control	III	—				
B5	1.5	VT/GN	439	Run/Crank Ignition 1 Voltage 4	II	—				
B6 - C6	—	-	—	Not Occupied	_	—				
C7	1	RD	2040	Secondary Fused Battery Positive Voltage 20	I	—				
C8 - D1	—	-	_	Not Occupied	_	—				
D2	10	RD/YE	—	_	V	—				
E1	10	RD/YE	1042	Primary Fused Battery Positive Voltage 10	V	—				
E2 - F5	—	-	—	Not Occupied	_	—				
F6	0.5	GN/GY	465	Fuel Pump Primary Relay Control	I	—				
F7 - G2	—	-	_	Not Occupied	_	—				
G3	1.5	YE/BU	318	Left Rear Trailer Stop/Turn Lamp Control	II	—				
G4 - G5	—	_	_	Not Occupied	_	_				
G6	2	RD/GN	1142	Primary Fused Battery Positive Voltage 11	III	—				
H1 - H2	—	-	_	Not Occupied	_	—				
H3	2	GN/BN	319	Right Rear Trailer Stop/Turn Lamp Control	III	—				
H4	1.5	RD/VT	1242	Primary Fused Battery Positive Voltage 12	II	—				

General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #158


August 26, 2019

GMC

UI Bulletin #158

H5	2	RD/VT	1940	Secondary Fused Battery Positive Voltage 19	III	—
H6	2	RD/YE	1242	Primary Fused Battery Positive Voltage 12	Ш	—

X138 Chassis Harness to Body Harness

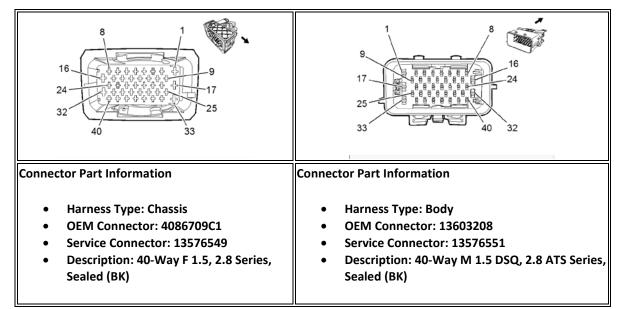

	Terminal Part Information												
Terminal Type ID	Terminated Lead	<u> </u>		Service Terminal	Tray Name	Core Crimp	Insulation Crimp						
I	13575429	J-35616-14 (GN)	J-38125-560	Not Available	Not Available	Not Available	Not Available						
II	13576369	J-35616-4A (PU)	J-38125-560	Not Available	Not Available	Not Available	Not Available						
	13580829	J-35616-4A (PU)	J-38125-36	Not Available	Not Available	Not Available	Not Available						
IV	13580830	J-35616-4A (PU)	J-38125-36	Not Available	Not Available	Not Available	Not Available						
v	19368143	J-35616-14 (GN)	J-38125-215A	Not Available	Not Available	Not Available	Not Available						
VI	13505807	J-35616-3 (GY)	J-38125-560	Not Available	Not Available	Not Available	Not Available						
VII	13578881	J-35616-5 (PU)	J-38125-36	Not Available	Not Available	Not Available	Not Available						
VIII	13580827	J-35616-5 (PU)	J-38125-36	Not Available	Not Available	Not Available	Not Available						

General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #158

August 26, 2019

UI Bulletin #158

	IX	19	9352419	J-35616	6-3 (GY)	J-38125-560		lot ilable	Not Availa	ble Av	Not ailable	Not Available	
				X	138 Cha	ssis Harness to Body	/ Har	ness					
Pin	Size	Color	Circuit	Terminal Type ID	Option	Function	Pin	Size	Color	Circuit	Terminal Type ID	Option	
1	0.5	GN/BK	7633	IV	_	Trailer Brake Control User Gain Signal	1	0.5	GN/BK	7633	VIII	_	
2	0.75	wн/ви	5986	I	_	Serial Data Communication Enable	2	0.5	WH/BU	5986	VI	_	
3	0.5	YE	7635	II	_	Trailer Brake Control Manual Apply Signal	3	0.5	YE	7635	VI	_	
4	0.5	BU/RD	7632	II	_	Trailer Brake Control Switch 5V Reference	4	0.5	BU/RD	7632	VI	_	
5	0.5	BN	7634	II	_	Trailer Brake Control Redundant Manual Apply Signal	5	0.5	BN	7634	VI	_	
6	0.5	BK/BN	7631	II	_	Trailer Brake Control Switch Low Reference	6	0.5	BK/BN	7631	VI	_	
7	—		_	—	_	Not Occupied	7	—	_	_	_		
8	1 0.75	VT/GY VT/GY	1054 1054	I	FQT -FQT	Stop Lamp Control 2 Stop Lamp Control 2		0.75	VT/GY	1054	VI	_	
9	0.5	BU/BN	4498	II	_	High Speed GMLAN Serial Data [+] 7	9	0.5	BU/BN	4498	VI	<u> </u>	
						Data [+] 7							

		<u> </u>							
—	—	—	_	Not Occupied	13	—	—	—	_
BN/GN	19	I		Right Rear Stop/Turn Signal Lamp Control	12	0.75	BN/GN	19	VI
YE/BU	18	I		Left Rear Stop/Turn Signal Lamp Control	11	0.75	YE/BU	18	VI

High Speed

Data [-] 7

GMLAN Serial

10 0.5

WН

4499

VI

General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #158

10

11

12

13

0.5

1

1

WН

4499

II

August 26, 2019



	<u> </u>	1	<u> </u>				1	<u> </u>		<u> </u>	ı	
14	0.75	WH/BU	6311	I	_	Cruise/ETC/TCC Brake Signal	14	0.35	WH/BU	6311	IX	_
15	_	_	_	_	_	Brake Fluid Level Switch Signal	15	0.5	GN/GY	333	VI	_
16 - 17	_	_	_	_	_	Not Occupied	16 - 17	_	_	_	_	_
18	0.5	BU	2500	II	_	High Speed GMLAN Serial Data [+] 1	18	0.5	BU	2500	VI	_
19	0.5	WН	2501	II	_	High Speed GMLAN Serial Data [-] 1	19	0.5	WН	2501	VI	_
20	0.5	VT/YE	5985	II	_	Accessory Wake- Up Serial Data	20	0.5	VT/YE	5985	VI	_
21 - 22	_	_	_	_	_	Not Occupied	21 - 22	_	_	_	_	_
23	1.5	GY/BN	309	v	_	Right Park Lamp Control	23	0.5	GY/BN	309	VI	_
24	1	GN/VT	619	I	_	Right Rear Turn Signal Lamp Control	24	0.75	GN/VT	619	VI	_
25	—	—	—	—	_	Not Occupied	25	—	—	_	—	_
26	0.75	GN/GY	6095	I	_	Right Rear Air Suspension Solenoid Valved Control	26	0.5	WH/GN	320	VI	_
27	_	—	_	_	_	Not Occupied	27	—	_	_	_	_
28	0.75	GN	6094	I	_	Vehicle Level Control Left Rear Air Spring Solenoid Valve Control	28	0.5	GN	10138	VI	_
29	0.5	BK	2550	П	_	Ground 25	29	0.75	BK	2550	VI	_
30	0.5	wн	6974	II	_	Rearview Camera Low Reference	30	0.5	ВК	6974	VI	_
31	—	_		_		Not Occupied	31	_	_	_		
32	1.5	BU	47	Ш	_	Trailer Auxiliary Control	32	2.5	BU	47	VII	_
33 - 35	_	_	_	_	_	Not Occupied	33 - 35	—	_	_	_	_

General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #158

Page | 8

August 26, 2019

GMC E



36	0.75	GN/VT	1430	I		Exterior Courtesy Lamp Control	36	0.75	WH/VT	1430	VI	_
37	0.75	GY/YE	6972	I	—	Rearview Camera Signal [+]	37	0.35	GY/YE	6972	IX	—
38	0.75	WH/BU	6973	I	—	Rearview Camera Signal [-]	38	0.35	WH/BU	6973	IX	—
39 - 40	_	_	_	_	_	Not Occupied	39 - 40	_	_	_	_	_

Additional Information:

Once the chassis wiring has been completely retrofitted the after-market brake controller can installed and can utilize the provisioned connector cavity in the IP (X61) junction with harness P/N 23184088 as shown below





General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #158

August 26, 2019