

MASTER COACHBUILDER INFORMATION UPDATE

Date: October 6, 2017Bulletin Number: XTS 47Subject: 2018 XTS B9Q Funeral Coach Excessive Current Drain

2018 XTS B9Q Funeral Coach has had an early build issue – the battery has been quickly discharging/draining. The cause is the radio module (CSM) staying awake/not falling asleep without the back-up lamp being connected.

To avoid battery discharge/current drain, the assembly plant/distribution centers have removed the 15 amp fuse in cavity #4 in the I/P BEC fuse box (see diagram below) from VINs (last 8) J9500005 through J9500034 and J9500036 through J9500046. Full VIN list attached. The I/P BEC is located behind the coin box in the I/P. For these VINs, the loose fuse should be in the cupholder and coachbuilders must reinstall it when they connect a back-up lamp to the wiring harness in the vehicle.

For B9Q VINs produced AFTER 2GEXG7U35J9500046, the assembly plant will install a jumper/shunt inline to the MBWH (instead of removing the fuse). Coachbuilders must remove the jumper/shunt when they connect a back-up lamp to the wiring harness. Note: Coachbuilders will have an additional cal file to download on 2018 B9Q Funeral Coach vehicles that have the shunt installed.

IP BEC LABEL R1 R3 R2 R1 R2 R3 18 <u>L</u> 19 14 20 15 21 16 17 22 23 9 10 11 8 24 IEC BOX CONTENT 25 SUPPLIER P/N RATING FUNCTION COMPONENT TYPE RELAY/FUSE/BREAKEF 12 13 COMPONENT 26 i 1- 10A- ONSTAI 16- 10A- G/BOX LAT ONSTAR MINIFUSE 10A 12092079 2-10A-BCM 7 17- 10A- HVAC/CNTRL 3-15A-BCM 5 BCM 7 MINIFUSE 10A 12092079 10A-ESCL BCM MINIFUS RADIC 7- 10A- SAFETY1 22- 2A- SW PWF 8- 15A- BCM 1 23- 15A- BCM 3 9-15A-BCM 4 24- 15A- BCM 2 30A- BCM 8 15A- PWR COLUM - 25A- PASS/S OX LAT RLY 13- 25A- DRVR/SEAT EMPTY 14-7.5A-DLC DUTLET RLY 15- 10A- AIRBAG AOS 84319940

Please contact Ray Bush or Joe Pennington with any questions.